
# Supernova 13 Pound Digital Scale

Model # P136PL-C

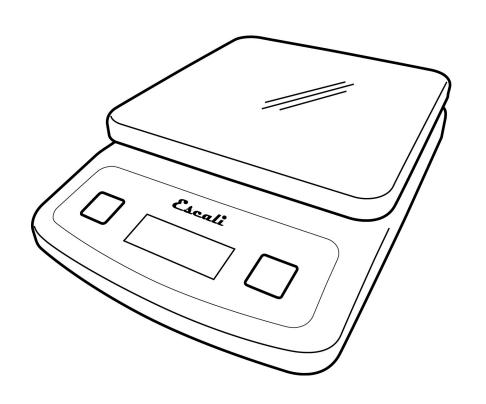

www.escali.com

## **INITIAL SETUP**

- 1. Insert batteries into the battery compartment located beneath the scale.
- 2. Place the stainless steel plate on the scale.

#### **WEIGHT MEASUREMENTS**

- 1. Press the **On/Tare/Off** button to turn on the scale.
- 2. Press the **g/oz** button to change units of measure.
- 3. Place an item on the scale in the center of the platform.

# **TARE (ADD & WEIGH)**

## Ignore the weight of a container:

- 1. Turn on the scale and place the container on the platform.
- 2. Press the **On/Tare/Off** button, and zero weight will display.
- 3. Add items into the container to be weighed.

## Find the individual weight of multiple items in one container:

- 1. Press On/Tare/Off to reset the scale back to zero weight.
- 2. Add additional items to be weighed.
- 3. Repeat steps 1-2 for additional items.

## Reset the scale back to zero weight:

 If nothing is on the scale and it does not read zero weight, press the On/Tare/Off button to reset the scale back to zero weight.

**Attention!** The scale will tare any amount of weight. Once the total weight actually on the scale reaches the maximum capacity of 13 pounds (6000g) the overload warning code (EEEE) will display.

## **AUTOMATIC SHUT-OFF**

The scale will turn off after 5 minutes of inactivity to save battery.

## **OVERRIDE AUTOMATIC SHUT-OFF**

A switch to over-ride the auto shut-off is located inside the battery compartment. Turn the switch "**ON**" to over-ride the auto shut-off feature.

## **OPTIONAL 9-VOLT WALL ADAPTER AVAILABLE**

The adapter is available at www.escali.com.

## PROPER USE & CARE

Use and stow the scale at room temperature.

- This scale is an instrument of precision. Do not submit the scale to shaking, excessive vibration, or other rough treatment; use on a flat, and stable surface.
- The display may be affected by electromagnetic disturbances such as radios, microwaves, or cell phones. If such disturbances occur, remove the source of the disturbance, and restart the scale.
- Disassembling, or tampering with the scale voids the warranty.
- Clean the scale with a damp cloth; do not submerge in liquid; scale is not waterproof.
- For best results, use alkaline batteries.
- Failure to insert batteries in the correct polarity, as indicated in the battery compartment, may shorten the life of the batteries or cause batteries to leak.
- Do not mix Alkaline, Standard (Carbon-Zinc) or Rechargeable (Nickel Cadmium) or (Nickel Metal Hydride) batteries. Do not mix old and new batteries.
- Batteries should be recycled or disposed of as per state and local guidelines. Do not dispose of batteries in fire!

## **WARNING MESSAGES**

EEEE Overload warning.

out2 Load cell is damaged or needs recalibration.

unst The scale is in an unstable environment.

Low battery warning.

## PRODUCT SPECIFICATIONS

Model: P136PL-C

Capacity: 13 lb / 6000 g

**Graduation:** Ounces: 0.05 oz (0 - 176 oz), 0.1 oz (176 - 211 oz)

Grams: 0.5 g (0 - 1000 g), 1 g (1000 - 6000 g)

Pounds: 0.001 lb

Pounds + Ounces: 0.1 oz

Product Dimensions: 5.75" x 8.25" x 1.5"

Platform Dimensions: 5.75" x 5.75"

**Power Source:** 2 - AA batteries (included), Optional 9-volt wall adapter (not included).

Automatic shut-off: 5 minutes

**NSF Certified** 

## **ESCALI CORPORATION**

3203 Corporate Center Drive, Suite 150 Burnsville, MN 55306 USA

# **PRODUCT SUPPORT**

24/7 Online support: https://escali.zendesk.com Email support: feedback@escali.com Phone support: 1-800-467-6408



# **2 YEAR PROFESSIONAL GUARANTEE**

This scale is guaranteed to be free of defects in materials and workmanship. For more details visit: www.escali.com/warranties

Escali's liability is limited to two (2) times the cost of the product.

© Escali Corp., Minneapolis, MN, USA. All rights reserved. Escali, the Escali logo and other Escali marks are owned by Escali Corp. and may be registered.

4